HEALTHCARE
Imaging >
Global Support Operations

HOME

Field Service Bulletin No. 55

Order No.: DD+DIS167.02E

1 piece VDRUS MA1

ADC Compact
Type 5145 / 100/101/140

Path Speed CR MP3010
Type 5145 / 200/201/240

Rating			When?		
safety relevant	reliability	new function	immediately	next service	as required
	X				X

Please file this document in section 13 of your technical documentation

Replacement of a broken light barrier flag at the Cassette Opener

Symptom
The light barrier flag (see figure beside) of the cassette opener of module 1 or 2 may break when it touches the frame of the cassette opener.

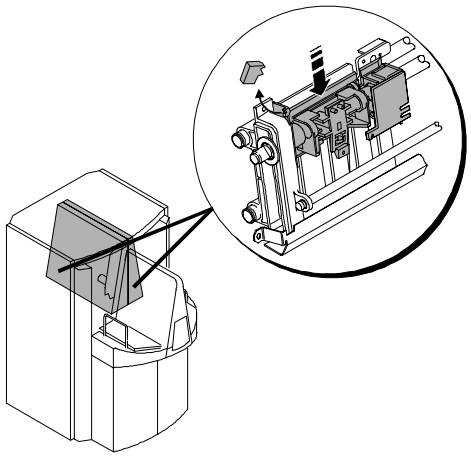

Reason
The cassette opener (LHS) remains in the home position and is not moved to the middle position when the cassette holder is lowered manually.

Solution
Exchange the broken part.
Order number: **CM+9.5146.5911.0**

Spare part can be ordered separately. It is not necessary to order a complete cassette opener!

printed in Germany 07 / 2002

AGFA